

Innergize Firmware Update Process for OWC ThunderBay Flex 8 & Gemini

1. Open the folder “Flex-8 & Gemini – GL3227-update-tool-v1.0”.

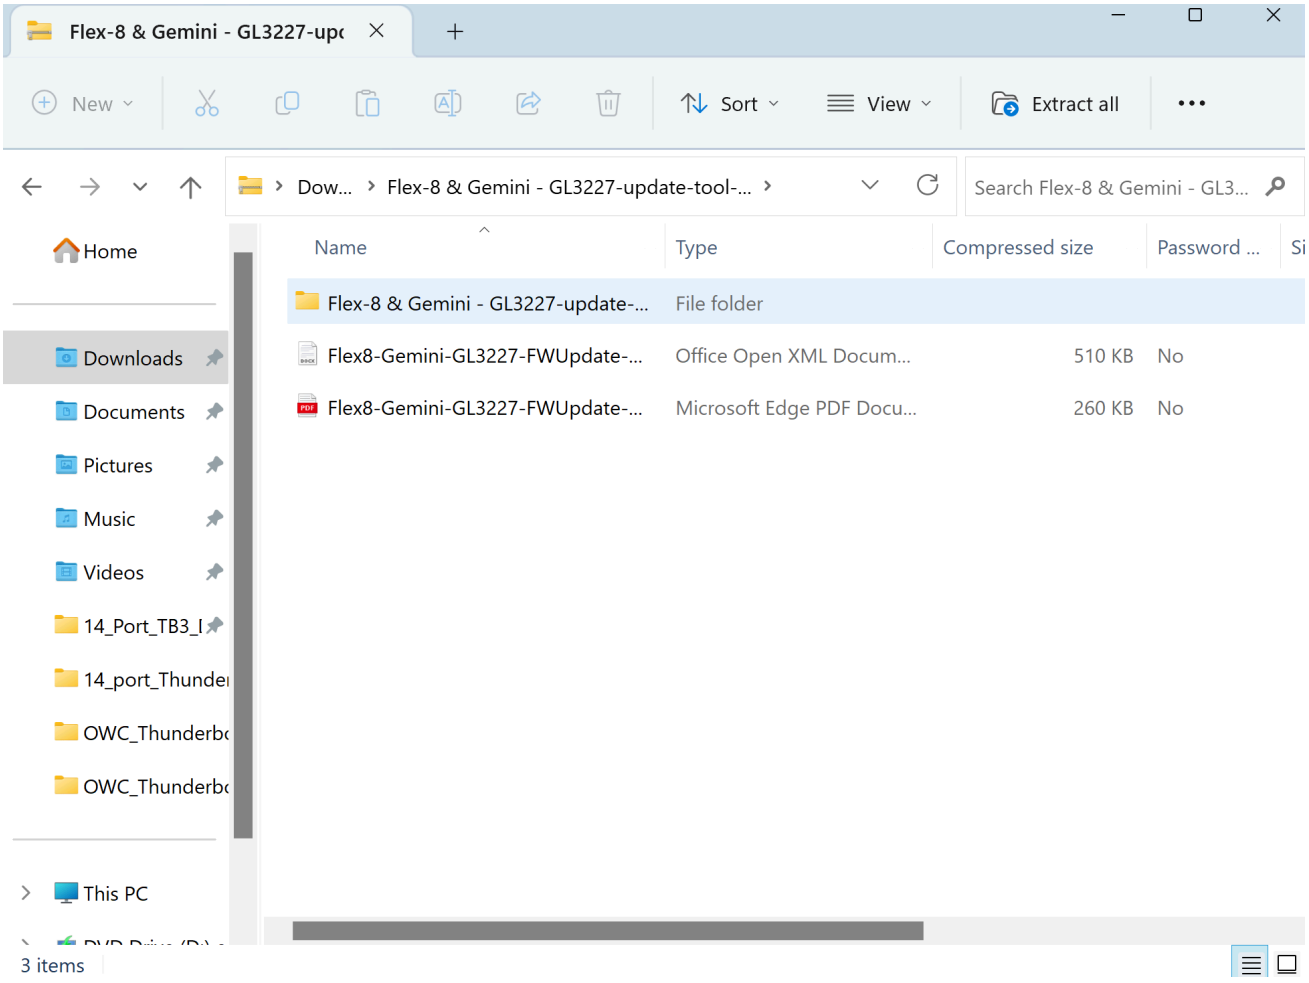


2. Highlight the “GLUpdateFWTool’ Application and Click “Extract all”.

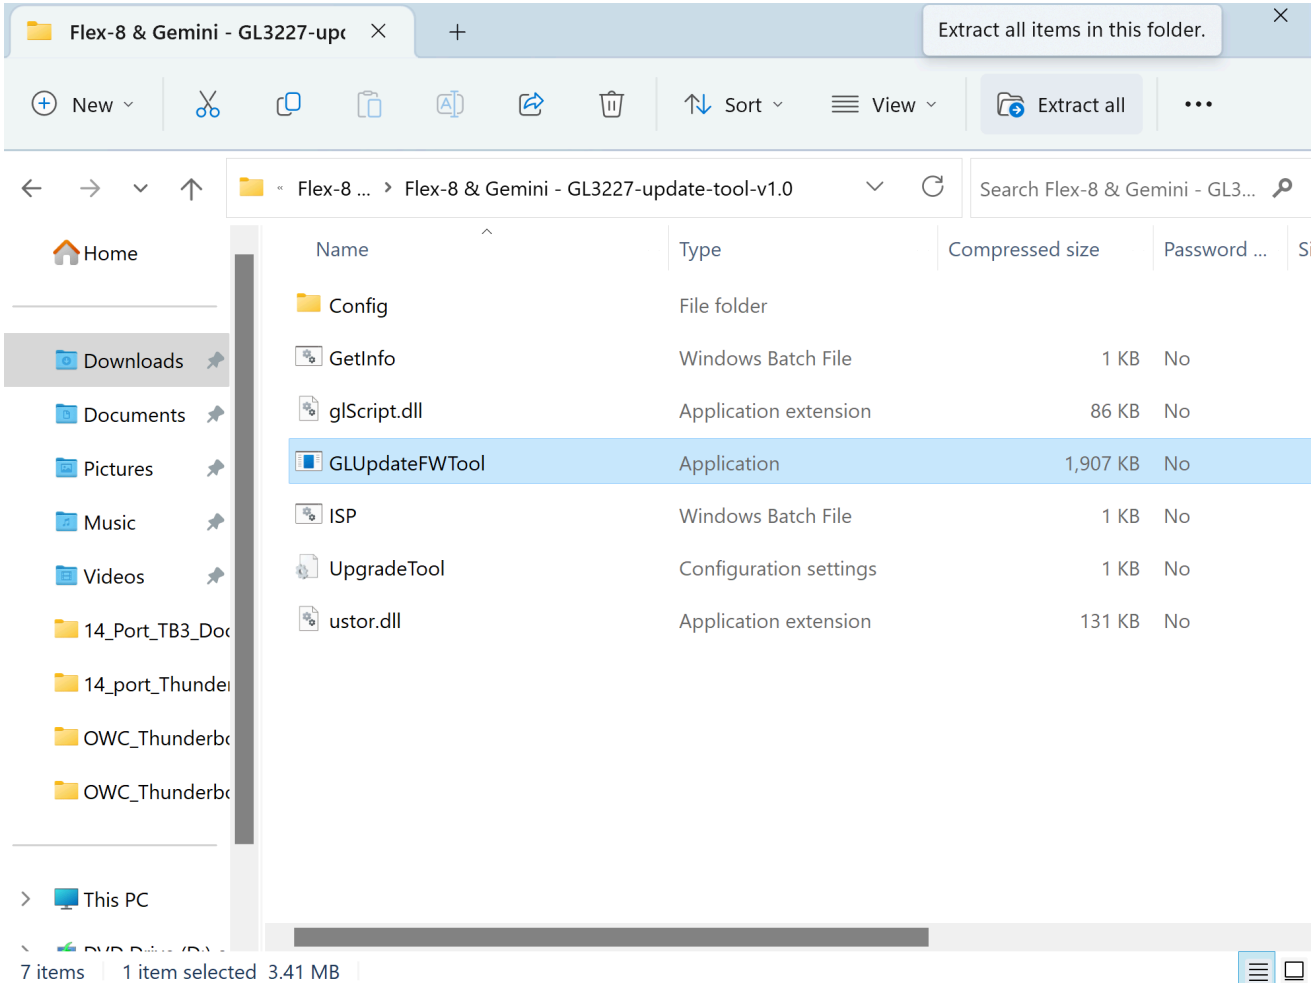


3. A security prompt may appear seeking permission to run the application, if so, Click “Yes’.


4. A destination prompt will appear. Leave the default destination provided and click Extract. This process will extract the firmware updater application. Note: Mac users will experience a wait as the files are extracted. Please be patient for a new window to appear containing the folder “Flex-8 & Gemini – GL3227-update-tool- v1.0”.

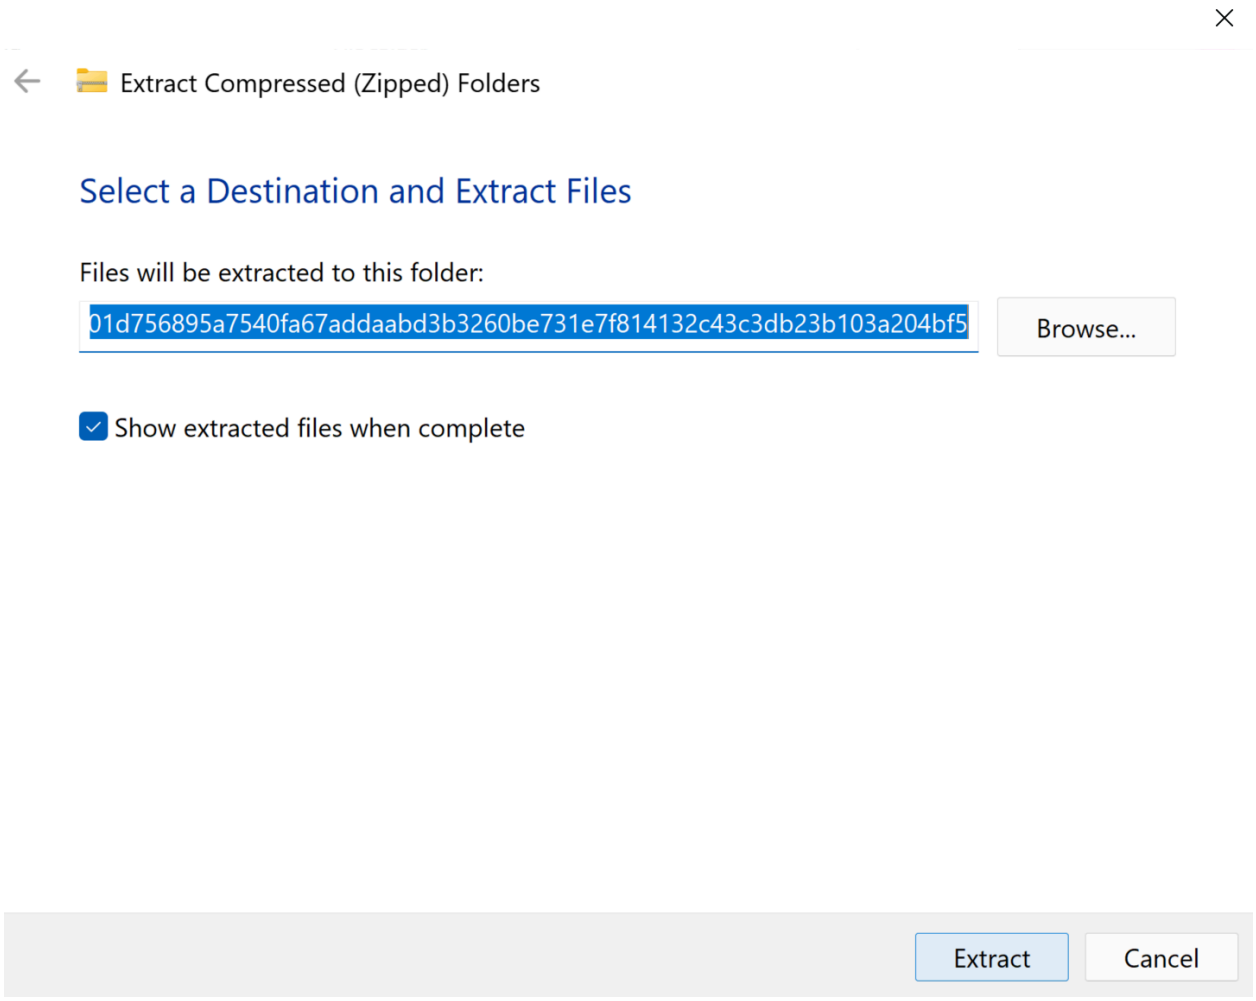


5. Open the folder “Flex-8 & Gemini – GL3227-update-tool- v1.0”.

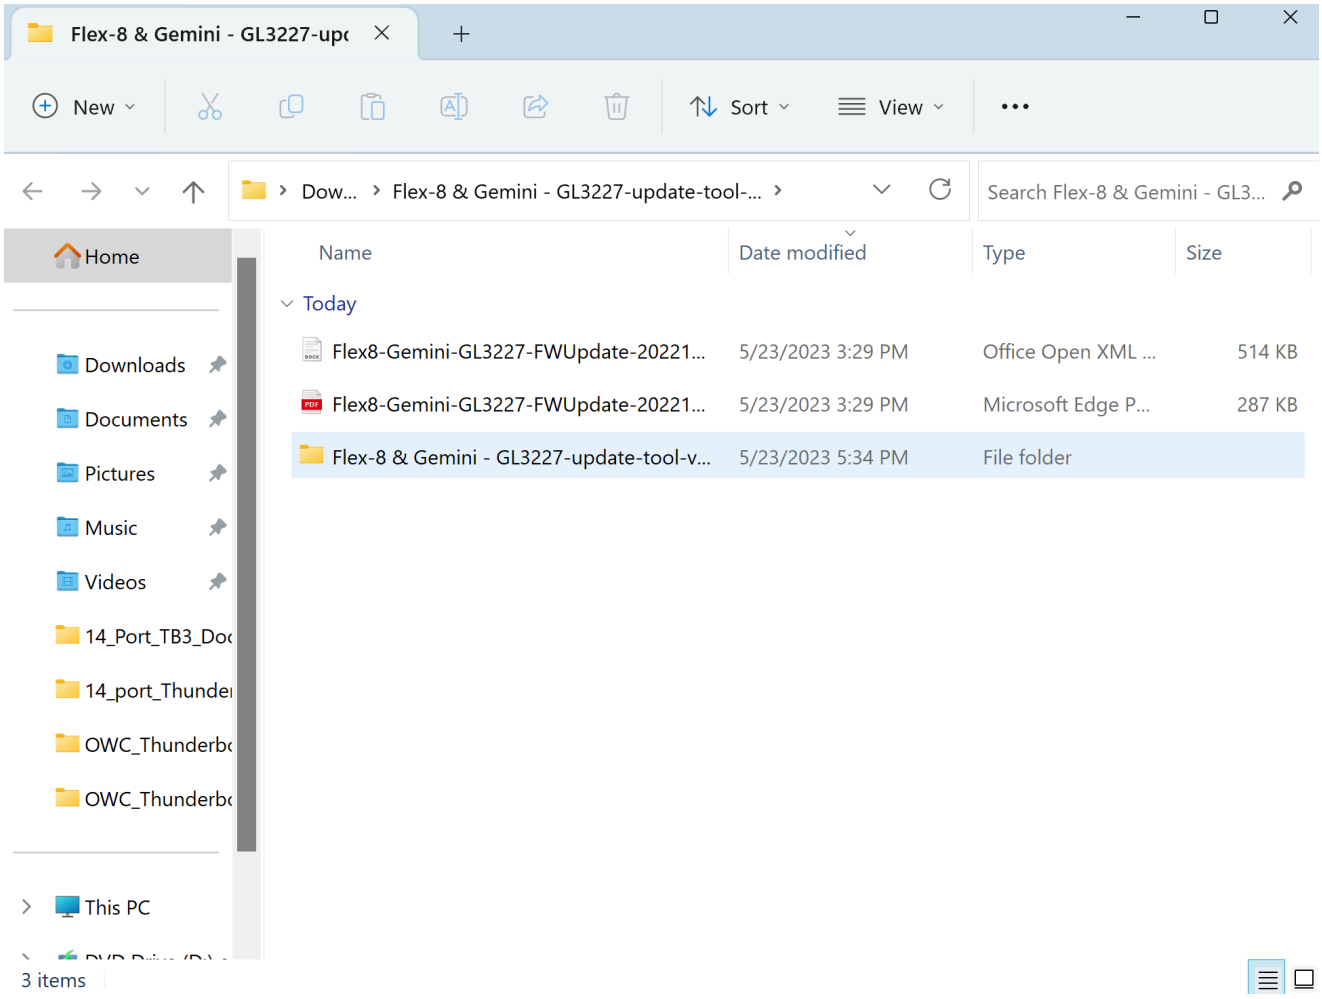


6. Double click the “GLUpdateFWTool” to lauch the firmware updater. A security prompt may appear seeking permission to run the application, click “Yes”.

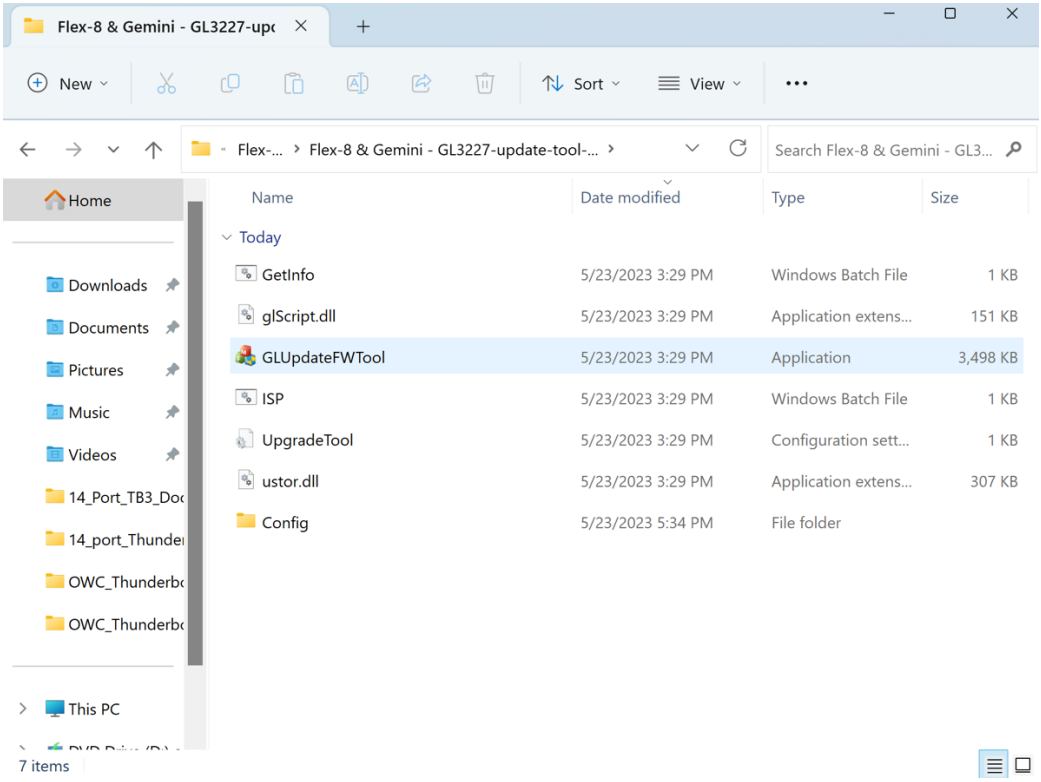

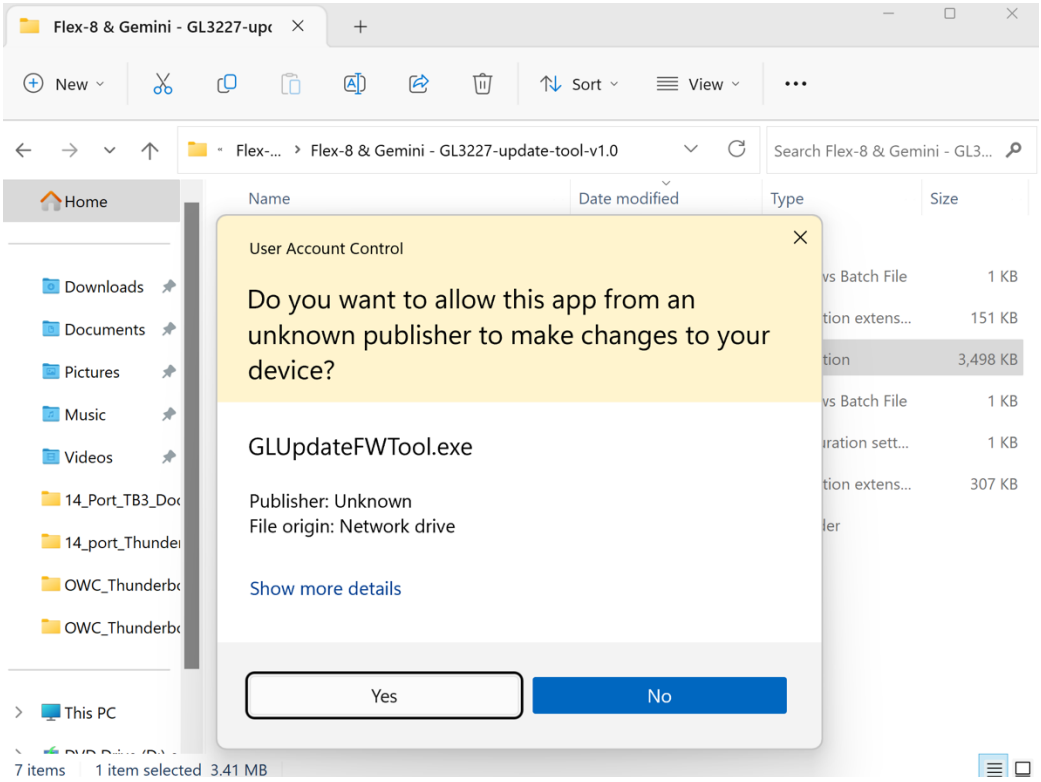

7. A firmware update window will appear displaying the current and new firmware versions. Click “Start” to begin the firmware installation.

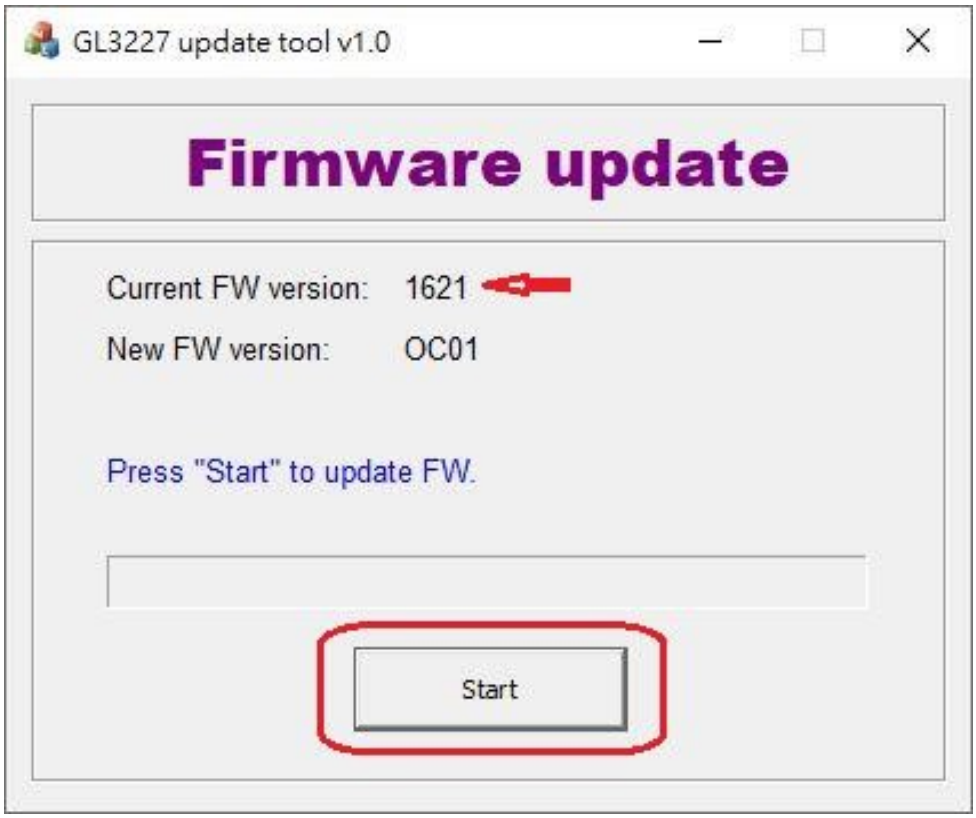

8. Click “OK” when prompted with “Do you want to update firmware from 1621 to OC01”.



9. Click “OK” when prompted with “FW Update Successful! Please re-plug your card reader device”.



10. The update is complete, and the device is ready for use. The current version of the firmware should now match the new firmware version.

